

 


# 56CR310 & 315 Cord Connectors

## WIRING INSTRUCTIONS

Recommended for use with  $0.75\text{mm}^2$  to  $1.5\text{mm}^2$   
PVC insulated ordinary duty 3 core circular flexible cords


STRIPPING  
DIMENSIONS  
(ACTUAL SIZE)



### WIRING DETAIL AND ASSEMBLY

Note: All wires are clamped between the moving nut and the fixed pin. DO NOT wrap wires under head of screw.

1. Open the flap and remove the connector base.
2. Slide the connector cover over the flex.
3. Strip insulation as illustrated and twist bare conductor strands.
4. Connect the Earth wire (Green/Yellow or Green) to the terminal marked 'E'.
5. Connect the Active (Live) wire (Brown or Red) to the terminal marked 'A'.
6. Connect the Neutral wire (Blue or Black) to the terminal marked 'N'.
7. Tighten cord clamp around the outer sheath of flexible cord. NOTE: There must be 10mm of sheath beyond the end of the cord clamp.
8. **Check the wires are in their correct position as illustrated and the terminal screws are tight.**
9. Slide the connector cover into place and ensure the fixing screws are fully tightened.

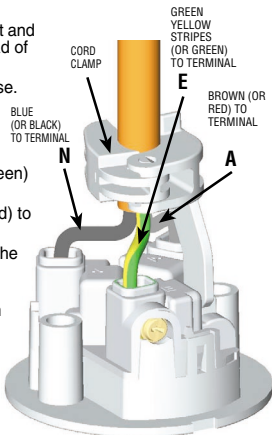

New Zealand Head Office: PO Box 15 355, Auckland, New Zealand  
Telephone +64-9-829 0490, Fax +64-9-829 0491  
[www.schneider-electric.co.nz](http://www.schneider-electric.co.nz)

Australia Head Office: Locked Bag 5500, Baulkham Hills Business Centre,  
NSW 2153, Australia  
Telephone +61-2-9851 2800, Fax +61-2-9629 8340  
[www.schneider-electric.com.au](http://www.schneider-electric.com.au)



PDL Electrical Products are  
manufactured by

